

Technical Bulletin



Date: February 2006

Type Policy Letter
√ Service Information

No: TCM-0025-B
Page 1 of 1

Attention Service Managers
√ Service and Parts Managers

Models

<u>Models</u>	<u>Serial range</u>
RFS12MP5A	xxxxxxxEJ (May 2004) thru 10418750GX (Dec 2005)
RFS12SW2A	xxxxxxxEJ (May 2004) thru 10418750GX (Dec 2005)

Brand
Amana

Issue Burned wires or spade connections at Interlock Primary Switch or Cavity TCO terminals.

Warranty Standard product manufacturing warranty applies.

Product
Com. Microwave

Action Recommended repair is to install Harness Repair Kit 12002722. This kit includes a new main harness, interlock switch, cavity TCO, and a red dot sticker.

All parts provided in the kit must be installed when performing this repair.

Repair part 12002722 is available from your Maytag Genuine Parts source.

Units that have already been **repaired** with this kit can be identified by a **red dot sticker** near the serial plate.

NOTE: Part number 12002722 will not be allowed for warranty repairs on units that have already had this repair kit installed.

When filing warranty claims for this repair, be sure to follow the instructions included in the repair kit (Project A8617).