

Technical Bulletin

Type Service & Parts Information

Date: March 2019

No: TCM-0319-A

Page 1 of 1

Attention Service & Parts Managers
Service Technicians

Product Restaurant Line Ovens: AFS*, RFS* & MFS*

Issue Intermittent no heat complaints caused by primary door switch's spring tension too strong.



9 9 2 1 8 R

2nd character = Year

3rd character = Month

Solution Inspect primary door switch's date code. If switch date code denotes it was made in 2018 (8 in the 2nd position) or January 2019 (9 in the 2nd and 1 in the 3rd position), install new door switch assembly Part Number 14164113.