

Technical Bulletin

MAYTAG®

Date: April 2006

Type Policy Letter
√ Service Information

No: TCM-0028-B
Page 1 of 1

Attention Service Managers
√ Service and Parts Managers

Brand
Amana

Models Amana RC Chassis Commercial Microwaves Ovens
RC17S, RC17S2, RC17SD2, RC17SD2OSI, RC17SED, RC17SX,
RC22S, RC22S2, RC27S, RC27S2, RC30S, RC30S2,
DQ22HSI, DQ22HSI2, KFC2, KFC2W2,
MC23MP, MC23MPW2, MC23MPT, MC23MPTW2,
ASE7000, ASE70002, ASE9000, ASE90002


Issue Seal holes in Cavity Bottom when replacing Lower Antenna Motor or Oven Tray

Warranty Standard product manufacturing warranty applies.


Product
Com. Microwave

Action If replacing the Lower Antenna Motor or Oven Tray on these models, seal the three holes shown below with RTV sealant at the same time.

Analysis of failed lower antenna motors has indicated some failures may be caused by grease dripping through these holes and on to the motor.

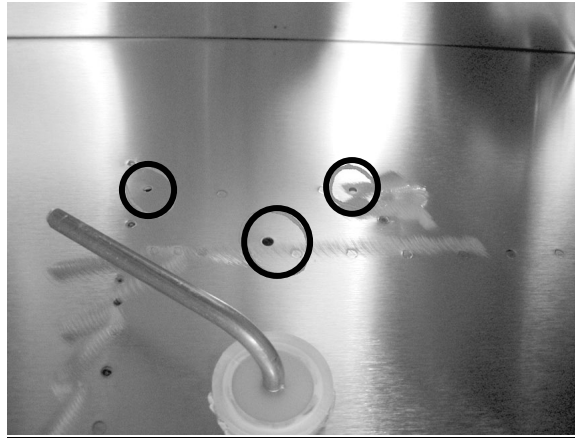

View from inside cavity with tray removed

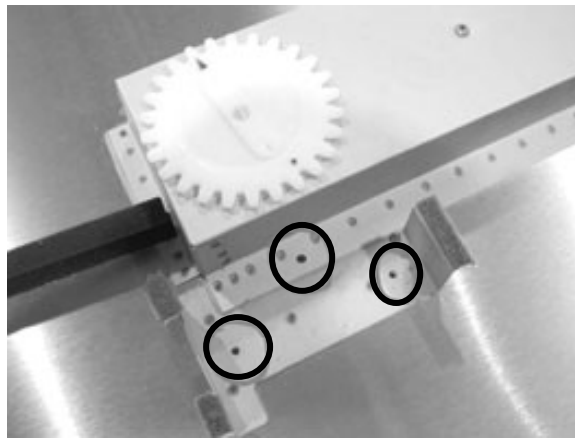

View from under side of cavity with access panel removed