

# Technical Bulletin

# MAYTAG®

**Date:** June 2006

**Type** Policy Letter  
Service Information

**No:** ITCM-0017-B  
Page 1 of 1

**Attention** Service Managers  
Service and Parts Managers

**Models** Amana RC Chassis and Menumaster MRC Chassis Commercial Microwave Ovens

**Brand**  
Amana  
MenuMaster


**Issue** Seal holes in Cavity Bottom when replacing Lower Antenna Motor or Oven Tray

**Product**  
Com. Microwave


**Warranty** Standard product manufacturing warranty applies.

**Action** If replacing the Lower Antenna Motor or Oven Tray on these models, seal the three holes shown below with RTV sealant at the same time.

Analysis of failed lower antenna motors has indicated some failures may be caused by grease dripping through these holes and on to the motor.

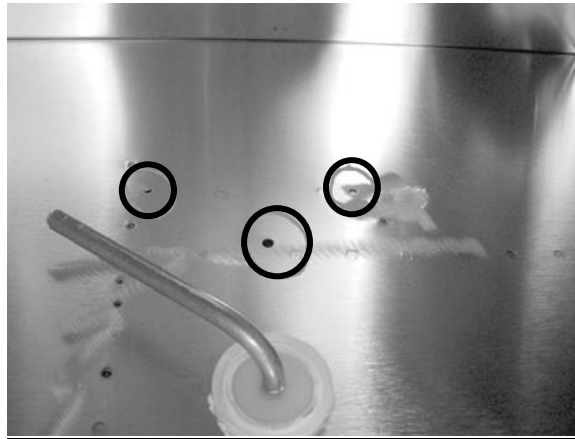

View from inside cavity with tray removed

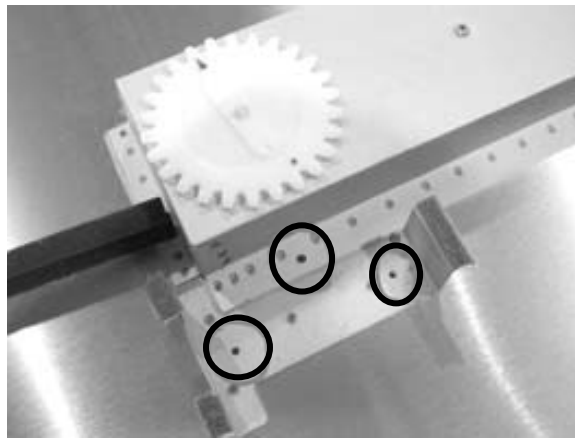

View from under side of cavity with access panel removed