

Technical Bulletin



Type Service & Parts Information

Date: July 2019


No: ITCM-0619-A

Attention Service & Parts Managers
Service Technicians

Page 1 of 1

Product 50hz High Speed Xpress Ovens: AXP* (Amana) & MXP* (MenuMaster)

ACP, Inc. has recently received approval from our testing agency, Intertec, the Cavity Thermal Cutout (Part#B5795317) may be removed and safely bypassed should one be found in an open condition with no other oven faults.

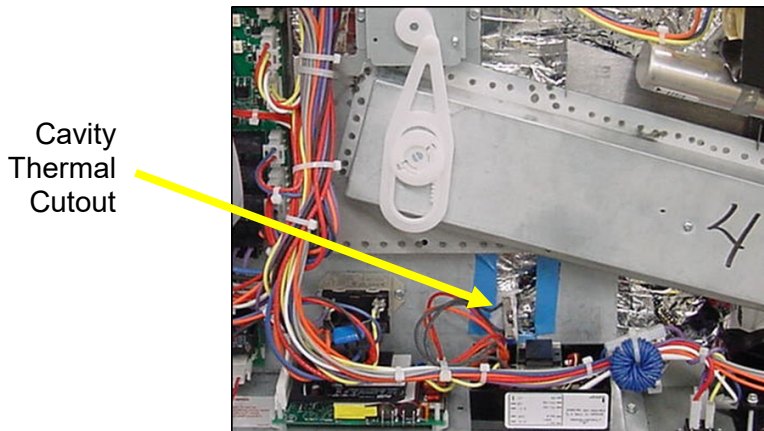

1. Cut the connectors off both ends of RD84 (at TCO and Reset Switch Connections)
2. Cut old connector and install new 1/4 Female Spade Connector on red Reset Switch wire)
3. Attach RD93 to new connector on Reset Switch.

Reference: IEC 60355-2-90 & IEC 60335-2-42 REPORT#102316154MIN-001