

Technical Bulletin

Date: November 25, 2015

Type Service Information

No: TCM-0089-B
ITCM-0066-B
Page 1 of 2

Attention Service and Parts Managers

Product Compact Models: CHDC*, CRC*, DEC*, HDC*, MDC*, MCHDC*

Issue New manufacturing series P20038xxM

Warranty Standard product warranty applies.


Action New functional parts

ACP has introduced a new manufacturing series (P20038xxM) of compact models effective with mid November 2015 production. Significant changes include:

Antenna Shield 59154460. Changes include:

- release tabs on the front sides which fit into slots in the cavity.
- embossed orientation icons to remind installer of proper alignment.

NOTE: This new shield is **NOT** backward compatible with 59124202.

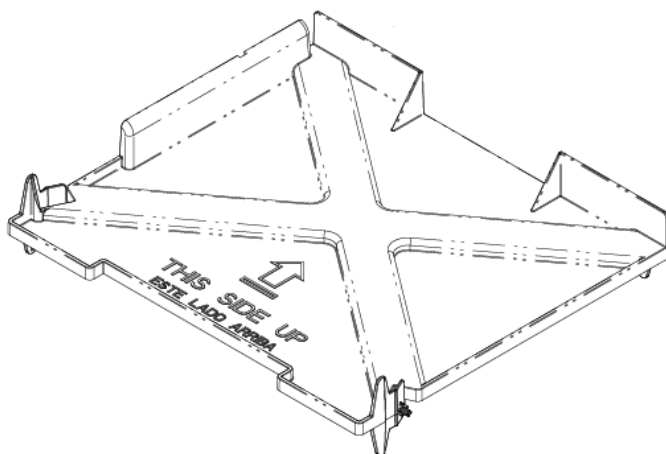


release tab

Ceramic Tray 59154461. Changes include:

- new tray material
- gasketed tray includes pre-applied molded gasket. RTV sealant is no longer required.

NOTE: This new tray is **NOT** backward compatible with 14109040 or 14159092. Replacement part includes the tray only. Tray supports will need to be ordered separately, if needed.

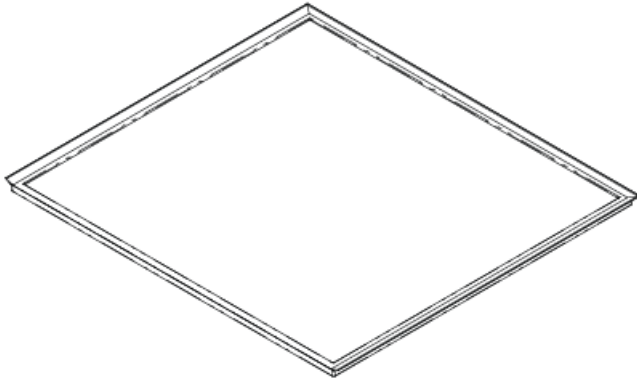

LED interior lamps

- 59154464 LAMP-LED 3W, 220/240V (for 50 HZ models)
- 59154465 LAMP-LED 3W, 208/240V (for 60 HZ 208/240V models)
- 59154466 LAMP-LED 3W, 120V (for 60 HZ 120V models)



Wrapper 12408503Q.

- In conjunction with the long life LED lamps, the lamp cover has been removed from the outer case wrapper

Cavity Kits 14159099 (1800/2100 watt models) and 14159098 (HDC12/MDC12 only)

- kits include the latest antenna shield and ceramic tray.